

## **Latest Firmware Update for the DR-1X Repeater**

Dear DR-1X Operators;


Thank you for your patronage of YAESU products.

Please be informed that we released the latest firmware updates for the DR-1X Repeater. The update solves a TX Lock-up problem when connecting directly to the HRI-200, and we recommend installation for all DR-1X units.

Before installing the new firmware, please determine the appropriate firmware version for your DR-1X. There are three different firmware versions depending on marketing regions.

To check the firmware version of your DR-1X Repeater;

1. Turn Power ON
2. Press "SET UP" Button on the Operation Mode Screen
3. The current Firmware Version is displayed at the top of the Screen

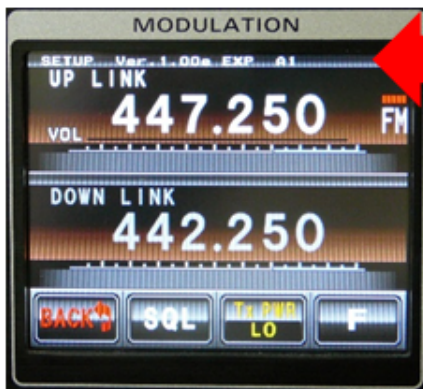

**Please use the appropriated new firmware to provide the listed functions:**

- V1.00n** Replaces any firmware versions, other than V1.10D and V1.00f.  
Provides **Wide-FM operation**
- V1.10J** Replaces V1.10D.  
Provides **Selectable Wide/\*Narrow-FM operation** and  
Supports **Connectivity direct to the HRI-200**
- V1.00t** Replaces V1.00f (If the DR-1X already has V1.00t, it does not need this update).  
Provides **Selectable Wide/\*Narrow-FM operation**  
(\*The narrow band deviation is for some European countries.)

**Thank you for your attention and continued support of YAESU.**